


**OIK®****Only Industrial Corp.** (Since:1976)95-1,Sec.2 Chung-Yang South Road, Peitou, Taipei, Taiwan 112  
Tel: 886 2 2891 4028, Fax: 886 2 2895 3536**OIK Bearing Co.**E-mail: oik@onlycorp.com  
http://www.onlycorp.com

## Bearing Rollers

# Dz- Dzp-

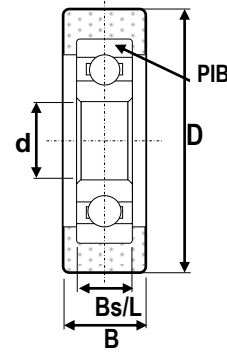

Unit: mm

Roller #	D	B	d	C	E	Bs/L	Ld/kg	Bearings #	gm/pc	F
<b>Dzp-1554</b>	<b>15</b>	<b>5</b>	<b>4</b>			<b>2.5</b>	<b>15</b>	<b>940zp</b>	<b>2.5</b>	<b>b</b>
<b>Dzp-1654</b>	<b>16</b>	<b>5</b>	<b>4</b>			<b>2.5</b>	<b>15</b>	<b>940zp</b>	<b>2.6</b>	<b>b</b>
<b>Dzp-1666</b>	<b>16</b>	<b>6</b>	<b>6</b>			<b>3.5/3</b>	<b>22</b>	<b>686zp</b>	<b>3</b>	<b>g</b>
<b>Dzp-1766</b>	<b>17</b>	<b>6</b>	<b>6</b>			<b>3.5/3</b>	<b>22</b>	<b>686zp</b>	<b>3</b>	<b>g</b>
<b>Dzp-19475</b>	<b>19</b>	<b>4.8</b>	<b>5</b>			<b>3</b>	<b>25</b>	<b>695zp</b>	<b>3.5</b>	<b>g</b>
<b>Dzp-1966</b>	<b>19</b>	<b>6</b>	<b>6</b>			<b>4</b>	<b>25</b>	<b>696zp</b>	<b>4 f</b>	<b>b</b>
<b>Dzp-1965</b>	<b>19</b>	<b>6</b>	<b>5</b>			<b>3</b>	<b>25</b>	<b>695zp</b>	<b>4 f</b>	<b>b</b>
<b>Dzp-1975</b>	<b>19</b>	<b>7</b>	<b>5</b>			<b>3</b>	<b>25</b>	<b>695zp</b>	<b>4 f</b>	<b>b</b>
<b>Dzp-22575</b>	<b>22</b>	<b>5.7</b>	<b>5</b>			<b>3</b>	<b>25</b>	<b>695zp</b>	<b>4</b>	<b>b</b>
<b>Dz-2276</b>	<b>22</b>	<b>7</b>	<b>6</b>			<b>4</b>	<b>30</b>	<b>696zp</b>	<b>10</b>	<b>L</b>
<b>Dz-25488</b>	<b>25.4</b>	<b>8.2</b>	<b>8</b>			<b>7</b>	<b>35</b>	<b>608zzG</b>	<b>10</b>	<b>bg</b>
<b>Dz-25488ss</b>	<b>25.4</b>	<b>8.2</b>	<b>8</b>			<b>7</b>	<b>25</b>	<b>S608zzG</b>	<b>10</b>	<b>bg</b>
<b>Dz-2541007</b>	<b>25.4</b>	<b>10</b>	<b>7</b>			<b>6</b>	<b>25</b>	<b>607zz</b>	<b>11</b>	<b>b</b>
<b>Dzp-2675</b>	<b>26</b>	<b>7</b>	<b>5</b>			<b>3</b>	<b>25</b>	<b>695zp</b>	<b>10</b>	<b>g</b>
<b>Dzp-2875</b>	<b>28</b>	<b>7</b>	<b>5</b>			<b>3</b>	<b>25</b>	<b>695zp</b>	<b>11</b>	<b>b</b>
<b>Dz-2676ss</b>	<b>26</b>	<b>7</b>	<b>6</b>			<b>6</b>	<b>30</b>	<b>S626zz</b>	<b>13</b>	<b>b</b>
<b>Dzp-3076</b>	<b>30</b>	<b>7</b>	<b>6</b>			<b>4</b>	<b>35</b>	<b>696zp</b>	<b>9.0</b>	<b>L</b>
<b>Dzp-3086</b>	<b>30</b>	<b>8</b>	<b>6</b>			<b>4</b>	<b>35</b>	<b>696zp</b>	<b>11</b>	<b>L</b>
<b>Dz-30858</b>	<b>30</b>	<b>8.5</b>	<b>8</b>			<b>7</b>	<b>42</b>	<b>608zzG</b>	<b>18</b>	<b>bg</b>
<b>Dz-30858ss</b>	<b>30</b>	<b>8.5</b>	<b>8</b>			<b>7</b>	<b>42</b>	<b>S608zzG</b>	<b>18</b>	<b>bg</b>
<b>Dz-3085-6495</b>	<b>30</b>	<b>8.5</b>	<b>6.35</b>			<b>9.5</b>	<b>40</b>	<b>608zz-6495</b>	<b>17</b>	<b>bg</b>
<b>Dz-31858</b>	<b>31</b>	<b>8.5</b>	<b>8</b>			<b>7</b>	<b>42</b>	<b>608zzG</b>	<b>21</b>	<b>b</b>
<b>Dz-34888</b>	<b>34</b>	<b>8.8</b>	<b>8</b>			<b>7</b>	<b>42</b>	<b>608zzG</b>	<b>22</b>	<b>b</b>
<b>Dz-35888</b>	<b>35</b>	<b>8.8</b>	<b>8.0</b>			<b>7</b>	<b>42</b>	<b>608zzG</b>	<b>20</b>	<b>b</b>
<b>Dz-3588-6495</b>	<b>35</b>	<b>8.8</b>	<b>6.35</b>			<b>9.5</b>	<b>42</b>	<b>608zzG-6495</b>	<b>21</b>	<b>b</b>
<b>Dz-388508</b>	<b>37.5</b>	<b>8.5</b>	<b>8</b>			<b>7.0</b>	<b>45</b>	<b>608zzG</b>	<b>20</b>	<b>b</b>
<b>Dz-3885-6495</b>	<b>37.5</b>	<b>8.5</b>	<b>6.35</b>			<b>9.5</b>	<b>45</b>	<b>608zzG-6495</b>	<b>22</b>	<b>b</b>
<b>Dz-381270895</b>	<b>38</b>	<b>12.7</b>	<b>8</b>			<b>9.5</b>	<b>45</b>	<b>608zzG-0895</b>	<b>23</b>	<b>b</b>

(150416)